

YAMAHA SERVICE NEWS

7733 TELEGRAPH ROAD • MONTEBELLO, CALIFORNIA

MAIL ADDRESS: BOX 54540, LOS ANGELES, CALIF. 90054

AREA CODE: 213 • OVERLAND 5-5135

Service News 195

YL2C - STARTER DYNAMO


- * A new starter-dynamo now comes with the YL2C models starting with engine #510428. This new dynamo is designed to prevent high speed vibration and provide ease of servicing. It has been designed to prevent spark retarding at high RPMs.
- * A new armature puller is required to remove the armature assembly. These new 10mm pullers are available from both east coast and west coast Parts Departments.

<u>Part Name</u>	<u>Part No.</u>	<u>Price</u>
Armature Puller, 10mm	1012-1	\$1.00 No Disc.

New type yoke assembly is 90° off from old type unit.




YOKE ASSEMBLY

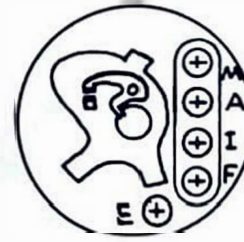


OLD TYPE CJ-FR
Part No. 165-81110-20

NEW TYPE CJ-F1R
Part No. 165-81110-21

New type governor assembly has been modified to match the new dynamo assembly.

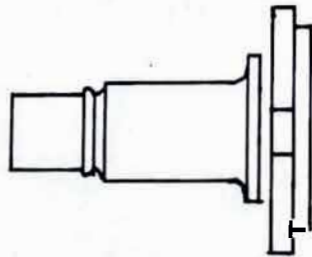

GOVERNOR ASSEMBLY

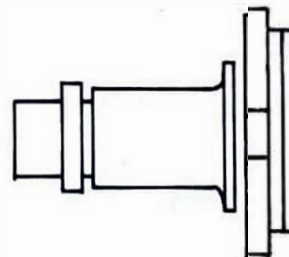


OLD TYPE G-167
Part No. 165-81153-20


NEW TYPE G-175
Part No. 165-81153-21

Armature assembly screw hole has been changed from 8mm to 10mm thread.

ARMATURE ASSEMBLY

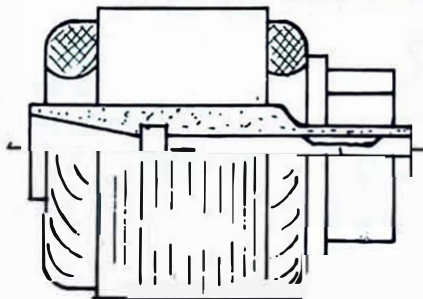

OLD TYPE M8 P1.25
Part No. 165-81155-20

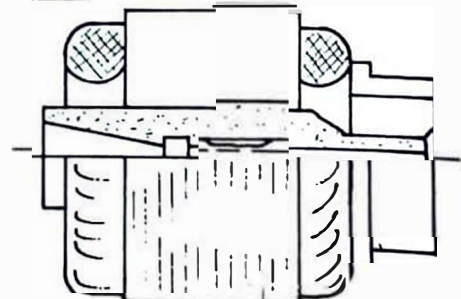

NEW TYPE M10 P1.25
Part No. 165-81155-21

** Service Note: Interchangeable as a set only.